

Virtual Services Platform 4000 Software Release 3.1.0.3

1. Release Summary

Release Date: June 2014

Purpose: Service Pack with corrected content to provide product update.

2. Important Notes before Upgrading to This Release

None.

3. Platforms Supported

Virtual Services Platform VSP 4850GTS

4. Special Instructions for Upgrade from previous releases

None.

5. Notes for Upgrade

Please see “*Virtual Services Platform 4000, Release Notes*” for software release 3.1.0.0 (NN46251-401, 03.15) available at <http://www.avaya.com/support> for details on how to upgrade your Switch.

File Names For This Release

File Name	Module or File Type	File Size (bytes)
VSP4K.3.1.0.3.tgz	Release 3.1.0.3 archived software distribution	76209777
VSP4K.3.1.0.3_modules.tgz	Release 3.1.0.3 Encryption Modules	37809

Note about image download:

Ensure images are downloaded using the binary file transfer.

Check that the file type suffix is “.tgz” and the image names after download to device match those shown in the above table. Some download utilities have been observed to append “.tar” to the file name or change the filename extension from “.tgz” to “.tar”. If file type suffix is “.tar” or file name does not exactly match the names shown in above table, rename the downloaded file to the name shown in the table above so that the activation procedures will operate properly.

Load activation procedure:

software add VSP4K.3.1.0.3.tgz

software add-modules 3.1.0.3.GA VSP4K.3.1.0.3_modules.tgz

software activate 3.1.0.3.GA

6. Version of Previous Release

Software Version 3.0, 3.0.1, 3.1, 3.1.0.2

7. Changes in 3.1.0.3

New Features in This Release

No new features in this release

Old Features Removed From This Release

No features removed from this release.

Problems Resolved in This Release

ID	Description
wi01175148	While boot-up, when the trial license file was read, a device reset was seen causing the switch to go into continuous reboot.
wi01175087	VSP 4000 rebooted itself with a core dump when ping tool in EDM is used i.e. Configuration -> Edit -> Diagnostics-> Ping/Trace Route.
wi01175082	Unable to access EDM after SSL Heartbleed Scan v3.3.3.0, http tasks were observed in a loop with CPU at 100%.
wi01175085	Filter acl with control-action option doesn't get saved in config. For example, if you configure "filter acl set 111 default-action deny control-packet-action deny", "control-packet-action deny" is not saved in config.
wi01176653	MCoSPB packets not getting de-capsulated correctly on UNI interfaces

8. Outstanding Issues

No new issues are outstanding based on this service pack release. For prior outstanding issues, Please see the "Virtual Services Platform 4000, Release Notes release 3.1.0" (NN46251-401, 03.15) available at <http://www.avaya.com/support> for details regarding Known Issues.

9. Documentation Corrections

For other known issues, please refer to the product release notes and technical documentation available from the Avaya Technical Support web site at: <http://www.avaya.com/support>.



Copyright © 2014 Avaya Inc - All Rights Reserved.

The information in this document is subject to change without notice. The statements, configurations, technical data, and recommendations in this document are believed to be accurate and reliable, but are presented without express or implied warranty. Users must take full responsibility for their applications of any products specified in this document. The information in this document is proprietary to Avaya.

To access more technical documentation, search our knowledge base, or open a service request online, please visit Avaya Technical Support on the web at: <http://www.avaya.com/support>