

Product Support Notice

© 2015 Avaya Inc. All Rights Reserved.

PSN # PSN004410u

Original publication date: 22-Jan-15. This is Issue #01, published date: Severity/risk level Low Urgency Immediately 22-Jan-15.

Name of problem Avaya Aura IP Deskphone Endpoints - Shellshock Bash for Wind River bash Security Vulnerabilities

Products affected

9601, 9608, 9608G, 9611G, 9621G, & 9641G, both SIP and H.323

B189 H.323 IP Conference Phone

Problem description

Wind River have issued a security vulnerability notices affecting all versions of the Bash package as shipped with Wind River products where the bash is enabled. The GNU Bourne Again shell (Bash) is a shell and command language interpreter compatible with the Bourne shell (sh).

A flaw was found in the way Bash evaluated certain specifically crafted environment variables. An attacker could use this flaw to override or bypass environment restrictions to execute shell commands. Certain services and applications allow remote unauthenticated attackers to provide environment variables, allowing them to exploit this issue.

References

- Wind River ASA-2014-382 https://downloads.avaya.com/css/P8/documents/100183088
- Wind River Advisory https://support.windriver.com/olsPortal/faces/maintenance/downloadDetails.jspx?contentId=044289

Resolution

Product:	Affected Version(s):	Risk Level:	Actions:
Avaya 9601/9608/9608G/9611G/9621G/9641G IP Deskphones	6.4.1.25 and earlier SIP software	Low	Upgrade to SIP software 6.5.0 GA or later.
Avaya 9608/9608G/9611G/9621G/9641G IP Deskphones	6.4.0.14 and earlier H.323 software	Low	Upgrade to H.323 software patch release 6.4.0.46 or later.
Avaya B189 IP Conference Phone	1.0.1.08 and earlier B189 software	Low	Upgrade to software patch release 1.0.1.25 or later.

96x1 H.323 -

 $\underline{ftp://ftp.avaya.com/incoming/Up1cku9/AvayaT4APP/IPT/96x1PatchesAndSoftware/R6.4xx/Shellshock/96x1-IPT-H323-R6_4_0_46-111014.zip$

96x1 SIP -

ftp://ftp.avaya.com/incoming/Up1cku9/tsoweb/9600/01122015/96x1-IPT-SIP-R6 5 0-121114.zip

B189 H.323 -

 $\frac{\text{ftp://ftp.avaya.com/incoming/Up1cku9/AvayaT4APP/IPT/B189PatchesAndSoftware/1.0.1/Shellshock/B189-IPT-H323-R1\ 0\ 1\ 25-111014.zip}{\text{11}}$

Workaround or alternative remediation

None

Remarks

The following Avaya IP Deskphone and Conferencing Products are **not** affected:

- 1110, 1120E, 1140E, 1150E, & 1165E
- 1210, 1220, & 1230
- 1603, 1603SW, 1603-I, 1608, 1608-I, 1616, & 1616-I
- 1692 IP Conference Phone
- 9610, 9620, 9620L, 9630, 9630G, 9640, 9640G, 9650, 9650C, and 9670

- A175 Avaya Desktop Video
- B179 IP Conference Phone
- E129 SIP IP Deskphone
- E169 Media Station

Patch Notes

The information in this section concerns the patch, if any, recommended in the Resolution above.

The information in this section concerns the patch, if any, recommended in the Resolution above.	
Backup before applying the patch	
n/a	
Download	
n/a	
Patch install instructions	Service-interrupting?
n/a	No
Verification	
n/a	
Failure	
n/a	
Patch uninstall instructions	

Security Notes

The information in this section concerns the security risk, if any, represented by the topic of this PSN.

Security risks

n/a

n/a

Avaya Security Vulnerability Classification

Low

Mitigation

n/a

If you require further information or assistance please contact your Authorized Service Provider, or visit support.avaya.com. There you can access more product information, chat with an Agent, or open an online Service Request. Support is provided per your warranty or service contract terms unless otherwise specified in the Avaya support Terms of Use.

Disclaimer: ALL INFORMATION IS BELIEVED TO BE CORRECT AT THE TIME OF PUBLICATION AND IS PROVIDED "AS IS". AVAYA INC., ON BEHALF OF ITSELF AND ITS SUBSIDIARIES AND AFFILIATES (HEREINAFTER COLLECTIVELY REFERRED TO AS "AVAYA"), DISCLAIMS ALL WARRANTIES, EITHER EXPRESS OR IMPLIED, INCLUDING THE WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE AND FURTHERMORE, AVAYA MAKES NO REPRESENTATIONS OR WARRANTIES THAT THE STEPS RECOMMENDED WILL ELIMINATE SECURITY OR VIRUS THREATS TO CUSTOMERS' SYSTEMS. IN NO EVENT SHALL AVAYA BE LIABLE FOR ANY DAMAGES WHATSOEVER ARISING OUT OF OR IN CONNECTION WITH THE INFORMATION OR RECOMMENDED ACTIONS PROVIDED HEREIN, INCLUDING DIRECT, INDIRECT, CONSEQUENTIAL DAMAGES, LOSS OF BUSINESS PROFITS OR SPECIAL DAMAGES, EVEN IF AVAYA HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES.

THE INFORMATION PROVIDED HERE DOES NOT AFFECT THE SUPPORT AGREEMENTS IN PLACE FOR AVAYA PRODUCTS. SUPPORT FOR AVAYA PRODUCTS CONTINUES TO BE EXECUTED AS PER EXISTING AGREEMENTS WITH AVAYA.

All trademarks identified by ® or TM are registered trademarks or trademarks, respectively, of Avaya Inc.

All other trademarks are the property of their respective owners.