



Avaya IP Deskphone H.323 Release 6.6.3 Readme

This file is the Readme for the Avaya Deskphone H.323 Release 6.6.3 software. This file describes the contents of the August 2016 (**6.6.3.02**) software distribution package.

Avaya Deskphone H.323 6.6.3 software is supported on the Avaya 9608, 9608G, 9611G, 9621G 9641G and 9641GS IP Deskphones only and when used with Avaya Aura[®] Communication Manager and Avaya IP Office[™]. The Avaya Deskphone H.323 6.6.3 software will not load or operate on any other models.

This release supersedes all previous Avaya Deskphone H.323 6.x.x software releases. Avaya recommends that all customers using Avaya Deskphone H.323 6.x.x software upgrade to this version at their earliest convenience.

The information in this document is accurate as of the issue date and subject to change.



Please refer to the advisements in this file for important information prior to deploying this software.

Avaya Aura[®] Communication Manager Compatibility

The Avaya 9608, 9608G, 9611G, 9621G, 9641G, and 9641GS IP Deskphones using Avaya Deskphone H.323 Release 6.6.3 software are supported on:

- Avaya Aura[®] Platform 6.2 FP4 (Avaya Aura[®] Communication Manager 6.3.6, Avaya, Avaya Aura[®] System Manager 6.3.8) and associated service packs
- Avaya Aura[®] Platform 7.0.0 (Avaya Aura[®] Communication Manager 7.0.0, Avaya Aura[®] System Manager 7.0.0) and associated service packs
- Avaya Aura[®] Platform 7.0.1 (Avaya Aura[®] Communication Manager 7.0.1, Avaya Aura[®] System Manager 7.0.1) and associated service packs

Avaya IP Office[™] Compatibility

The Avaya 9608, 9608G, 9611G, 9621G, 9641G, and 9641GS IP Deskphones using Avaya Deskphone H.323 Release 6.6.3 software are supported on:

- IP Office[™] 9.0 Service Pack 5
- IP Office[™] 9.1 and associated service packs.
- IP Office[™] 10.0

New features in H.323 6.6.3

Avaya Deskphone H.323 Release 6.6.3 contains the following new features:

New with this release	Description
Enhanced display of Name and Number in Call Log list	<p>When viewing information in the "Call Log" list, this enhancement allows for the choice of displaying only names, only numbers, or both. Names that are too long to fit in the available space will be truncated on the right (i.e. show the beginning characters of the name) and the numbers that are too long to fit in the available space will be truncated on the left (i.e. show the ending numbers).</p> <p>Note: This change only applies when the IP Deskphone is used on Communication Manager.</p> <p>Note: Refer to parameter CLDISPCONTENT.</p>
Ability to specify the frequency of Call Log backups	<p>Customers now have the ability to specify the frequency with which the Call Logs on the phones will be backed up.</p> <p>Note: Refer to parameters CLBACKUPTIMESTAT and CLBACKUPTIME.</p>
Option to show blank login screen when user has logged out.	<p>Deskphones can be configured to not display any entry in the "extension" field or "password" field on out logged-out deskphone.</p> <p>Note: Refer to parameter CLEAR_EXTPSWD_ON_LOGOUT.</p>
27 character name stored in call log details	<p>The number of characters which can be displayed for a name in call log details is increased to 27 characters from the previous limitation of 20 characters.</p> <p>Note: Communication Manager may not always send the complete 27 characters to the IP Deskphone with the result being truncated characters at the end of the name in the call log.</p>

Documentation for H.323 6.6.3

The following documentation has been updated to support this release of software.

- [Administering Avaya 9608/9608G/9611G/9621G/9641G/9641GS IP Deskphones H.323](#)

The following documentation has not been updated and is included below for reference.

- [Installing and Maintaining Avaya 9608/9608G/9611G/9621G/9641G/9641GS IP Deskphones H.323](#)
- [Using Avaya 9608/9608G/9611G IP Deskphones H.323](#)
- [Using Avaya 9621G/9641G/9641GS IP Deskphones H.323](#)
- [9600 Series IP Deskphones Overview and Specification](#)
- [Using Avaya 9621G/9641G/9641GS IP Deskphones H.323](#)
- [Using 9600 Series H323 in a Call Center](#)
- [Avaya 9608/9608G/9611G IP Deskphones H.323 Quick Reference](#)
- [Avaya 9621G/9641G/9641GS IP Deskphones H.323 Quick Reference](#)
- [Avaya 9608/9608G/9611G/9621G/9641G IP Deskphones H.323 Call Center Quick Reference](#)
- [Guide to Icons – Avaya 9608/9608G/9611G/9621G/9641G IP Deskphones](#)
- [Application Note: EAP-TLS with 9600 Phones](#)
- [VPN Setup Guide for 9600 Series IP Deskphones](#)
- [Single Sign On for Local Devices – API Guide](#)
- [Avaya Deskphone H.323/SIP for 9600 Series – API Guide](#)

These documents are available on <http://support.avaya.com> under “9600 Series IP Deskphones” -> “H.323 6.6.x” -> Documents

H.323 6.6.3 Package Contents

The H.323 6.6.3 software package contains all the files necessary to upgrade Avaya new or previously installed 9608/9608G/9611G/9621G/9641G/9641GS IP deskphones to the H.323 6.6.3 load.

The following files are included in each package:

- S9608_11HALBR6_6_3_02_V474.tar - The 6.6.3 H.323 phone application tar file for 9608, 9608G and 9611G models.
- S9621_41HALBR6_6_3_02_V474.tar - The 6.6.3 H.323 phone application tar file for the 9621G, 9641G and 9641GS models.
- S9608_11_HALKRR6_6_3_02.bin - The 6.6.3 H.323 application binary file for 9608G and 9611G models.
- S96x1_UKR_V27r19_V27r19.tar - The 6.6.3 H.323 Kernel and root file system tar file.
- Deskphone H.323 6.6.1 files for interim upgrades if required:
 - S9608_11HALBR6_6_1_15_V474.tar - The 6.6.1 H.323 phone application tar file for 9608, 9608G and 9611G models
 - S9621_41HALBR6_6_1_15_V474.tar - The 6.6.1 H.323 phone application tar file for the 9621G, 9641G and 9641GS models
 - S96x1_UKR_V25r10_V25r10.tar - The 6.6.1 H.323 Kernel and root file system tar file
- 96x1Hupgrade.txt - This file is downloaded by the 9608/9611G/9621G/9641G/9641GS IP deskphones and instructs the phones on how to upgrade.
- 19 predefined language files for phone display:
 - mlf_96x1_V148_arabic.txt
 - mlf_96x1_V148_chinese.txt
 - mlf_96x1_V148_dutch.txt
 - mlf_96x1_V148_english_large.txt
 - mlf_96x1_V148_french_can.txt
 - mlf_96x1_V148_french_paris.txt
 - mlf_96x1_V148_german.txt
 - mlf_96x1_V148_hebrew.txt
 - mlf_96x1_V148_italian.txt
 - mlf_96x1_V148_japanese.txt
 - mlf_96x1_V148_korean.txt
 - mlf_96x1_V148_polish.txt
 - mlf_96x1_V148_portuguese.txt
 - mlf_96x1_V148_russian.txt
 - mlf_96x1_V148_spanish.txt
 - mlf_96x1_V148_spanish_latin.txt
 - mlf_96x1_V148_template_en.txt
 - mlf_96x1_V148_thai.txt
 - mlf_96x1_V148_turkish.txt
- av_prca_pem_2033.txt (Avaya Product Root CA certificate)
- Avaya-96x1IPTelephone-MIB.txt for reference
- AvayaMenuAdmin.txt template for reference
- release.xml

The signatures in the signatures subdirectory of the .zip distribution packages are only intended to be used by the file server, and the file server that is on the CM6.x/7.x Utility Server is the only file server that currently supports this.

System specific parameters should be entered into the 46xxsettings.txt file which is available for separate download at <http://support.avaya.com>. **New or changed configuration parameters with this release of software are shown in Appendix 3.**

The H.323 6.6.3 package is available in the following versions:

- Versions with encryption enabled
 - 96x1-IPT-H323-R6_6_3_02-081016.zip
- Versions with encryption disabled
 - 96x1-IPT-H323-R6_6_3_02U-081016.zip

Note: .tar files are no longer generated for Deskphone H.323 software.

Note: Deskphone H.323 6.6.1 binary files are included with this package as those are required for interim upgrades from a release prior to Deskphone H.323 6.6.1 to Deskphone H.323 6.6.2 or later to enable SHA2 image signature validation. Refer to the "Support for SHA2-signed software files" section for further information.

Advisements with H.323 6.6.3 software

9611G Global – Minimum Software Release

The 9611G IP Deskphone Global (Comcode 700504845/700501429, Model ID 9611GD02B) must use either Deskphone SIP 6.4.0.33 or later software or Deskphone H.323 6.4.0.14 or later software. **Attempts to downgrade these models to lower versions of software will be rejected.** If these models are implemented in an environment that uses lower versions of software for other IP Deskphones, it is recommended to use a mechanism to differentiate the software loads such as different HTTP servers or different GROUPs.

9611G Global – Minimum Software Release

The 9611G IP Deskphone Global (Comcode 700504845/700501429, Model ID 9611GD02C) must use either Deskphone SIP 7.0.1.0.45 or later software or Deskphone H.323 6.6.2.29 or later software. **Attempts to downgrade these models to lower versions of software will be rejected.** If these models are implemented in an environment that uses lower versions of software for other IP Deskphones, it is recommended to use a mechanism to differentiate the software loads such as different HTTP servers or different GROUPs.

9608G and 9608 Global – Minimum Software Release

The 9608G IP Deskphone (Comcode 700505992/700507946, Model ID 9641GD03A) and 9608 IP Deskphone Global (Comcode 700504844/700507947, Model ID 9608D02B) must use either Deskphone SIP 6.3.1.13 or later software or Deskphone H.323 6.3.1.16 or later software. **Attempts to downgrade these models to lower versions of software will be rejected.** If these models are implemented in an environment that uses lower versions of software for other IP Deskphones, it is recommended to use a mechanism to differentiate the software loads such as different HTTP servers or different GROUPs.

9608G Global – Minimum Software Release

The 9608G IP Deskphone (Comcode 700505424/700507946, Model ID 9608GD03B) must use either Deskphone SIP 7.0.1.0.45 or later software or Deskphone H.323 6.6.2.29 or later software. **Attempts to downgrade these models to lower versions of software will be rejected.** If these models are implemented in an environment that uses lower versions of software for other IP Deskphones, it is recommended to use a mechanism to differentiate the software loads such as different HTTP servers or different GROUPs.

9641GS – Minimum Software Release

The 9641GS IP Deskphone (Comcode 700505992/700509409/700509981, Model ID 9641GD03A) must use either Deskphone SIP 6.5.0.17 or later software or Deskphone H.323 6.6.0.25 or later software. **Attempts to downgrade these models to lower versions of software will be rejected.** If these models are implemented in an environment that uses lower versions of software for other IP Deskphones, it is recommended to use a mechanism to differentiate the software loads such as different HTTP servers or different GROUPs.

Interworking – TLS 1.2

Deskphone H.323 6.6.2 and later software upgrades TLS to support TLS 1.2.



Deskphone H.323 6.6.2 also adds a new configuration parameter (TLS_VERSION) which can be used to configure the Deskphone to only use TLS 1.2. Care must be taken to only use this parameter when all components to which the deskphone will communicate can also support TLS 1.2.

Interworking – HTTPS - MVIPTTEL, IIS 6

Deskphone H.323 6.6.2 and later software does not support secure HTTP (HTTPS) with MVIPTTEL or IIS 6. MVIPTTEL is end-of-support by Avaya and IIS 6 is end-of-support by Microsoft. Customers using either of these servers are recommended to upgrade to a current version of an HTTPS server which supports TLS 1.2.

Support for SHA2-signed software files

As part of the security enhancements in Deskphone H.323 6.6.2 or later software, the software files are signed using SHA-256 digital signatures. Deskphone H.323 6.6.1 software files are signed using SHA-1 digital signatures only and capable of SHA-1 and SHA-256 digital signature verification. Deskphone H.323 6.6.0 and earlier software files are signed using SHA-1 digital signatures only and capable of SHA-1 digital signature verification. Customers upgrading from Deskphone H.323 6.6.0 or earlier will automatically upgrade to Deskphone H.323 6.6.1 and from there to Deskphone H.323 6.6.2 or later. This interim upgrade is automatic but will result in an additional reset during this particular upgrade.

Interworking – Avaya Diagnostic Server (ADS)

Avaya Diagnostic Server 2.5.3 is required to support Deskphone H.323 Release 6.6.2 or later software.

H.323 6.6.3 Resolved Issues (since H.323 6.6.2)

The following table includes issues which are resolved with this release of software compared to H.323 6.6.2.29.

External ID	Internal ID	Issue Description
1-11520839080	H32396X1-13835	When using BRURI over TLS, under some environment, phone may show some delay on refreshing line appearance upon disconnecting a call.
1-11340538873	H32396X1-13697	Deskphones are configured via SET IDLEFEATURES to show the "Log Out" softkey. On the 9641G/9641GS, the "Log Out" softkey will intermittently disappear after a call has ended.
1-11892313605	H32396X1-13923	User uses "Visiting User" mode to register to a deskphone A. The user uses "Visiting User" mode to register to deskphone B. Deskphone A incorrectly shows the visiting user expiry warnings.
1-11314861052	H32396X1-13808	Call log cuts off 20th character from name field for outgoing internal calls.
1-11462471883	H32396X1-13813	Call is made to extension A with name A. Call log shows name A correctly. CM administrator changes name A to name B. When another call is made to extension A, the call log still shows name A instead of name B.
1-11462570413	H32396X1-13814	The first outgoing call to an busy internal extension A with name A shows in the call log with name "Unavailable" instead of name A.
1-11319718443	H32396X1-13715	9611G is configured for VPN. Label for softkey 4 is not aligned with physical softkey button.
	H32396X1-13863	After logging out guest user, phone shows "Backup failed" message.
	H32396X1-13875	When using VPN with VLAN configured running against VPN Juniper SSG 220 and Cisco ASA 5505 VPN gateways, phone may intermittently not get the file from the HTTP server.
	H32396X1-13869	9611G LCD screen "dim" out of the box for new installs
1-11892313541	H32396X1-13914	9641 Call Log details do not stay on previous entry
	H32396X1-13953	During a failed login attempt the phone flashes the display with the previous extension number
	H32396X1-13900	Intermittently, if CRAFT is being accessed quickly during boot, user may see some delay.
	H32396X1-13897	IPO: In case IPO system backup and restore is done during a call, Phone may remain in Discovery mode.
	H32396X1-13868	In case of 2 DHCP servers are used - if the first DHCP offer comes without option 242 and second DHCP offer is with valid option 242, phone will get IP of first DHCP and loops waiting for LLDP

External ID	Internal ID	Issue Description
	H32396X1-13936	In case AGC is turned on and user is playing dial tone on speaker for several seconds under a noisy environment, speaker volume level may be decreased a bit as part of AGC tuning.
	H32396X1-13818	On rare cases, world clock may not appear correctly on 9641GS
	H32396X1-13386	There is currently no MIB support to CTASTAT parameter. Though this parameter exists in the MIB file, querying it will return empty value.
1-11318918614	H32396X1-13743	VPN rekey fails with Cisco ASA 5525.
1-11565294300	H32396X1-13854	When the deskphone is not able to download the 46xxsettings.txt file upon reboot, it incorrectly adds a "0" upon callback from history.
1-11315185248	H32396X1-13843 H32396X1-13977	Deskphone is configured with 802.1x. PC#1 is connected to the deskphone and authenticated. PC#1 is shut down and disconnected. PC#2 is connected to the deskphone and powered up. A proxy logoff is incorrectly sent with the MAC address of PC#1.
1-11862195302	H32396X1-13926	When deployed on IP Office, neither "*" or "#" can be used with Name or Number in CONTACTS.
1-9372265833	H32396X1-13195	Deskphone does not insert PHNOL to the dialed number when the first digit is the same as PHNOL.
1-9252483795 1-9348183035	H32396X1-13050	Time on deskphone will drift (~ 40 seconds every 24 hours) if CM is not configured to periodically update the time/date.
	H32396X1-13856	On old headsets, such as Plantronics AWH65+, which aren't officially supporting EHS, there is sometimes noise on EHS GPIO pulse from the headset. Such noise may occasionally cause issues identifying on/off hook events from the headset. Though this is known with this specific headset, same issue may also occur on other old headsets which may also present such noise on EHS pulse.
1-11587631899	H32396X1-13946	9641G is configured to support a Bluetooth headset. User answers and incoming call using the headset. Another incoming call is made. User disconnects the call and ringing is provided to the Bluetooth headset. User answers the second call but ringing is still provided on the Bluetooth headset.

Unresolved issues in H.323 6.6.3

The following table includes unresolved issues with this release of software which were known as of the issue date for this document.

External ID	Internal ID	Issue Description
	H32396X1-14039	endptSLMSTAT MIB appear on our Avaya-96x1IPTelephone-MIB mib file, but is not supported by the phone. Please ignore it
	H32396X1-13984	endptNVRINGTONESTYLE has the wrong description in Avaya-96x1IPTelephone-MIB. Correct description is as follows – endptNVRINGTONESTYLE OBJECT-TYPE SYNTAX INTEGER MAX-ACCESS read-only STATUS current DESCRIPTION "Ringing style identifier. This variable returns the value of RINGTONESTYLE parameter which specifies the style of ring tones that are offered to the user for Personalized Ringing when Classic (as opposed to Rich) is selected. Value Operation 0 North American ring tones are offered (default) 1 European ring tones are offered" ::= { endptNVM 18 }
	H32396X1-14080	When querying endptAUTOANSSTAT MIB , it always returns 0. Value returned doesn't necessarily reflect the real parameter value, please ignore it's MIB returned value.
	H32396X1-14075	On rare occasions, selected line appearance gets highlighted with black background. Workaround: In case you encounter such occurrence, please downgrade to any other 96x1 H323 release, the problem will disappear. You may then upgrade again to the same release previously used.
	H32396X1-14033	When LOGUNSEEN is set to 1, The name of unseen call log is truncated when extension name has over 20 characters long
	H32396X1-14029	When changing TLS_VESION value from 0 to 1 when Radius server supports TLSv1.0 only, after enabling 802.1x "auto" and authenticating, phone needs to be rebooted for new settings to take place and use TLS 1.2 only.

External ID	Internal ID	Issue Description
	H32396X1-14027	<p>User data (extension) is expected to be shown on phone screen only when retrieval completes. In cases in which retrieval takes long due to faulty\unreachable backup info a blank screen with a message "Retrieval In Progress" will be seen until completed.</p> <p>Workaround: Please check backup server settings and reachability and correct those.</p>
	H32396X1-13999	<p>When using large font and names longer than 27 characters, call log details screen will not present the call log icon on 9621 and 9641 deskphones.</p>
	H32396X1-13983	<p>Deskphone is configured with HEADSYS 1 and a headset. User has answered an incoming call, the far end has disconnected, and the deskphone goes to an idle state with the headset button lit. If the user presses a dial pad key, they intermittently will hear DTMF tones via the headset.</p>
	H32396X1-13971	<p>Authentication screen title line may sometimes not get updated and not present title "Enter authentication credentials" headline. User may still enter credentials and proceed working correctly.</p> <p>Workaround: No functionality is harmed, in order to still see title line-</p> <ol style="list-style-type: none"> 1) On touch screen phone: Cancel the screen and select manual backup again, the status line will be displayed properly 2) On button phone: Restart the phone.
	H32396X1-13896	<p>In case Backup\Restore server is unavailable, phone does not display "Retrival Failed" message on top line right after login.</p> <p>Workaround: Message will be seen correctly for any change saved on backup (volume change, call log Etc.)</p>
	H32396X1-13853	<p>There may be rare cases in which BM is not properly updated.</p> <p>Workaround: plugout and plug in the BM</p>
	H32396X1-13826	<p>Limitation when using CTASTAT: In case of setting CTASTAT to any other value than 2 (default), Edit dialing function will wait for interdigit timeout vs. being treated like ENBLOC.</p> <p>Workaround: If you do not wish edit dialing will wait for interdigit timeout, please keep CTASTAT value 2 (default).</p>
	H32396X1-13796	<p>Intermittently, user cannot enter User ID on the HTTP authentication screen.</p> <p>Workaround: Navigate down to the "password" field and then back up to the "User ID" field.</p>
	H32396X1-13767	<p>Cancelling audio push using headset button while on a headset call results in no audio.</p> <p>Workaround: Use "Cancel" softkey to cancel the audio push.</p>

External ID	Internal ID	Issue Description
	H32396X1-13657	Backup file on the HTTP server is manually changed to reflect Display Language = English. User changes the display language to a non-English language and then does a manual restore. The display remains blank although the backup/restore is done successfully. Workaround: Press the Phone button.
	H32396X1-13701	On 802.1x, when setting MYCERTCN to \$MACADDR in 46xxsetting, Phone uses SERIALNO in Device ID instead of MAC.
	H32396X1-13068	When using MV_IPTTEL as WML browser with a home page including a wbmp format picture, the deskphone might reboot when trying to access this page. Workaround: delete the picture from the home page or use other type of HTTP server such as Microsoft IIS 7 or Avaya Utility Server.
	H32396X1-12890	In IPO environment doing a user login on top of an already logged in extension, the A menu will show incorrect the original phone configuration. This happens though the phone retrieved the new extension backup file. The issue happens only the first time entering the A-menu. Workaround: Re-entering the A-menu will show correctly the configuration retrieved from the backup file.
	H32396X1-12001	When feature, call appearance or bridged appearance is added on Station form for an existing station and CADISPMODE is set to 1 the labels set in the wrong order. Solution: Disconnect the Button Modules, logout, login and connect the Button Modules.
	H32396X1-11469	Call Appearance line numbers does not displays after rebooting the phone when personalize label given for extension.
	H32396X1-11886	Phone displays incoming call icon with conference call when CALLAPPRSELMODE and CADISPMODE set to 1.
	H32396X1-11981	When deskphone boot up and automatically log in with extension and agent, phone does not always retrieve extension backup file. Solution: manually logout and login the extension.
	H32396X1-11986	SLAMon is not supported over VPN.
	H32396X1-12026	Entered Thai characters do not display if language changed to English.

External ID	Internal ID	Issue Description
	H32396X1-11877	<p>When the phone is connected in IP Office environment, the call features (such as call pickup) cannot be accessed from "HOME" screen more than once.</p> <p>Solution: go to any other screen, then go back to "HOME" screen and activate the desired call feature again.</p>
	H32396X1-11911	<p>Korean only: Entering long personalized labels in feature screen will over write the feature checkbox.</p> <p>Solution: Shorten the personalized labels to fit the free space near the checkbox</p>
	H32396X1-11041	<p>Network delay values are high when a call is created between deskphone and E129 endpoints.</p>
	H32396X1-10773	<p>When a reset command is sent to the phone using a SAT terminal, talk path is lost but the phone doesn't reset immediately as expected.</p> <p>Solution: The reset will take place after the user disconnects the call.</p>
	H32396X1-10873	<p>Agent greeting of type VDN, will not work if VDN name configured on CM exceeds 15 characters. The phone supports 15 characters or less.</p> <p>Solution: Configure VDN names on CM to have 15 characters or less.</p>
	H32396X1-10861	<p>Incoming calls display the caller name from the CM server, not the local contact name. When the information from the CM server contains an alphanumeric name. For example, if the caller information in the CM is "John 123" and the name is saved in the local contact list as "John W", the phone screen displays "John 123" during the call, and "John W" in the call history.</p>
	H32396X1-10859	<p>Changes to the "Match Criteria" field while editing an agent greeting of type VDN/ANI is not saved.</p> <p>Solution: Editing any other field in addition to the match criteria will cause the values to be saved - for example change the greeting name by one letter.</p>
	H32396X1-10409	<p>The deskphone software supports both the Avaya Communication Manager and the Avaya IP Office Call Managers. A restore to factory defaults is required before switching between the Communication Manager environment and the Avaya IP Office environment. Failing to do so may result in various operational issues.</p> <p>Solution: For any abnormal behavior of the phone after switching between CM and IPO, go to CRAFT menu and clear values.</p>
	H32396X1-10225	<p>When changing MD5 to TLS and also changing user name on the server, the phone's authentication fails.</p> <p>Solution: Clear values through CRAFT menu.</p>

External ID	Internal ID	Issue Description
	H32396X1-9939	The deskphone supports SRTP AES 128 HMAC 80 cryptographic Suite only. Other cryptographic suites (un-authenticated suites and HMAC 32 based suites) are not supported.
	H32396X1-9194	When Cisco Access Control Server (ACS 5.2) is configured for re-authentication timeout, using TLS session tickets to renew authentication, the phone does not re-authenticate. Solution: reboot the phone
	H32396X1-10118	By opening a second call appearance and start dialing, agents are able to go back to the first call appearance and disconnect the live call.
	H32396X1-10642	When configuring the phone for large fonts and the display includes a call forward icon, a ringer off icon and more than 10 missed calls, the Media Quality Indicator would override the time field on the screen. Solution: use normal font size when configuring the phone to display a Media Quality Indicator.
	H32396X1-10082	Manual restore does not work when there is a logged in contact center agent. Solution: Log out the contact center agent, and keep the phone logged in to CM. The manual restore will work correctly at this state. Once the operation completes, log in the contact center agent again.
	H32396X1-7864	In some cases, when you move a phone between two CM servers that have the same station number with different configurations, the phone will not load the new configuration. Solution: Open the station details screen in CM and perform any update to the form. This triggers a configuration update to the phone and resolves the issue.
	H32396X1-7894	Using the IP redirect feature, the deskphone does not display the correct redirect server URL during the bootup sequence. The deskphone shows the original server UR instead.
	H32396X1-9477	If Audio report feature is active, the phone responds slowly for a few seconds until the report is complete.
	H32396X1-6339	In case the phone backup file is manually removed from the backup server, and then the phone reboots, the next backup operation would backup default parameters only. Solution: To ensure that the backup operation uses the correct backup parameters, do not remove the phone backup file from the backup servers manually

External ID	Internal ID	Issue Description
	H32396X1-7131	In a Call Center, switching audio devices (handset, headset or speaker) while agent greeting is being played causes the agent greeting to stop. Solution: Do not switch audio devices while the greeting is being played.
	H32396X1-7474	If OPSTAT is 00x or 0, OPTSTATCC and CALLCTRSTAT are set to 1, Advanced options functionality is not blocked.
	H32396X1-7040	When 'Timerstat' is set to 1 and 'Timer on' softkey is chosen while on an active call, the user timer blinks when the seconds advance. Solution: Use 'Timer on' softkey during idle state (not during an active call).
	H32396X1-5782	If a phone is ringing while a failover between primary and secondary CMs in a Processor Ethernet duplicate setup occurs, the ringing for the current call will stop. The phone will keep alerting silently until the call is answered or disconnected. The ringing will continue to function properly in the next call.
	H32396X1-5078	If the HTTP server is down, and the user is registered by static IP address and modifies call server IP address, changes are not reflected on the phone. Solution: Verify that the HTTP server is up and running before making administrative changes.
	H32396X1-4505	Arabic language is not supported on the 9608 desk phones.
	H32396X1-5697	After performing a downgrade of software, changing CM configuration of Button Module parameters and then upgrading again, labels are not updated on Button Module. Solution: Perform a "CLEAR" operation.
	H32396X1-7143	If you press a second call appearance while an auto answer greeting is being played, you hear the dial tone and the greeting at the same time.
	H32396X1-8872	If you use barge-in audio push after normal audio push, the deskphone may reset.
	H32396X1-8902	Phone does not support using DNS for WML host name or trusted push server Solution: Use IP address for WML host name or TPS host name.
	H32396X1-8812	When several certificates are provided and the first is invalid, phone will not continue to download other certificate. Solution: Use valid certificates.
	H32396X1-9582	Team button alert is shorter when using headset.

External ID	Internal ID	Issue Description
	H32396X1-9500	In Hebrew or Arabic, the "Enter" and "Bksp" soft keys are switched on VPN startup. Solution: When using those system languages, after entering a password, press "Bksp" to Enter and vice versa.
	H32396X1-9525	The agent greeting feature (including agent greeting recording) does not function with Bluetooth headsets. Only wired or DECT headsets are supported.
	H32396X1-9586	The deskphone does not support WML of Push display when its title contains "&" or "<".
	H32396X1-9667	Phone supports getting only one HTTP file server from LLDP. Solution: Multiple HTTP file servers can be configured using other ways such as settings file, DHCP and CRAFT menu.
	H32396X1-8897	If the phone is connected to the network using VPN, the BRURI parameter contains FQDN address and not the IP address, and the phone is logged out and sleep mode is activated, backup/restore will stop working until the next phone reboot. Solution: Configure IP and not FQDN when the phone is behind VPN.

Appendix 1 – Supported Hardware

H.323 6.6.3 software is supported on the following models of IP Deskphones.

Comcode	Short Description	Model	Note
700500254	9601	9601D01A	Ships with SIP software.
700506783	9601 GLOBAL	9601D01B	Ships with SIP software. Must use SIP 6.3.1.21 or later.
700480585	9608	9608D01A	
700504844	9608 GLOBAL	9608D02A	
		9608D02B	Must use SIP 6.3.1.13 or later, or H.323 6.3.1.16 or later.
700501428	9608 (TAA)	9608D02A	
700507947	9608 GLOBAL (TAA)	9608D02B	Must use SIP 6.3.1.13 or later, or H.323 6.3.1.16 or later.
700505424	9608G GLOBAL	9608GD03A	Must use SIP 6.3.1.13 or later, or H.323 6.3.1.16 or later.
		9608GD03B	Must use SIP 7.0.1.0.46 or later, or H.323 6.6.2.29 or later.
700507946	9608G GLOBAL (TAA)	9608GD03A	Must use SIP 6.3.1.13 or later, or H.323 6.3.1.16 or later.
		9608GD03B	Must use SIP 7.0.1.0.46 or later, or H.323 6.6.2.29 or later.
700480593	9611G	9611GD01A	
700501429	9611G (TAA)	9611GD01A	
700504845	9611G GLOBAL	9611GD02A	
		9611GD02B	Must use SIP 6.4.0.33 or later, or H.323 6.4.0.14 or later.
		9611GD02C	Must use SIP 7.0.1.0.46 or later, or H.323 6.6.2.29 or later.
700507948	9611G GLOBAL (TAA)	9611GD02B	Must use SIP 6.4.0.33 or later, or H.323 6.4.0.14 or later.
		9611GD02C	Must use SIP 7.0.1.0.46 or later, or H.323 6.6.2.29 or later.
700480601	9621G	9621GD01A 9621GD01C	
700506514	9621G GLOBAL	9621GD01C	
700500254	9621G (TAA)	9621GD01A 9621GD01C	
700506516	9621G GLOBAL (TAA)	9621GD01C	
700480619	9621G W/O FACEPLATE	9621GD01B 9621GD01D	
700480627	9641G	9641GD01A 9641GD01C	
700506517	9641G GLOBAL	9641GD01C	
700501431	9641G (TAA)	9641GD01A 9641GD01C	
700506519	9641G GLOBAL (TAA)	9641GD01C	
700480635	9641G W/O FACEPLATE	9641GD01B 9641GD01D	
700505992	9641GS GLOBAL	9641GD03A	Must use SIP 6.5.0.17 or later, or H.323 6.6.0.25 or later.
700509409	9641GS GLOBAL (TAA)	9641GD03A	
700509981	9641GS GLOBAL W/O FACEPLATE	9641GD03B	

Appendix 2 – Release History

The following table provides a history of the H323 6.2.x/6.3.x/6.4.x/6.6.x software releases. The "ID" column shows the identifier of this software which is seen on the "About Avaya one-X" or "About Avaya IP Deskphone" menu item.

Release	ID	Date	Link to Readme file
6.2.0	6.2009	February 2012	http://support.avaya.com/css/P8/documents/100157541
6.2.1	6.2119	June 2012	http://support.avaya.com/css/P8/documents/100162786
6.2.2	6.2209	July 2012	http://support.avaya.com/css/P8/documents/100165091
6.2.3	6.2312	January 2013	http://support.avaya.com/css/P8/documents/100169016
6.2.4	6.2408	May 2013	http://support.avaya.com/css/P8/documents/100172170
6.3.0	6.3037	August 2013	http://support.avaya.com/css/P8/documents/100174163
6.3.1	6.3116	January 2014	http://support.avaya.com/css/P8/documents/100177992
6.4.0	6.4014	June 2014	http://support.avaya.com/css/P8/documents/100180543
6.6.0	6.6029	May 2015	http://support.avaya.com/css/P8/documents/101009359
6.6.1	6.6115	Nov 2015	http://support.avaya.com/css/P8/documents/101016318
6.6.2	6.6229	May 2016	http://support.avaya.com/css/P8/documents/101023924
6.6.3	6.6302	Aug 2016	http://support.avaya.com/css/P8/documents/101027546

Appendix 3 – New/Changed 46xxsettings.txt parameters

The latest version of the 46xxsettings.txt file can be downloaded from <https://support.avaya.com/downloads/download-details.action?contentId=C2009071016160372125345&productId=P0553>.

New parameters.

```
## CLEAR_EXTPSWD_ON_LOGOUT specifies whether the extension and password are not displayed on a
## logged out deskphone.
## Value Operation
## 0 The extension and/or password are displayed depending upon other parameters (default)
## 1 The extension and password are not displayed in all cases
## This parameter is supported by:
## 96x1 H.323 R6.6.3 and later
```

Changed parameters (changes noted in red).

```
## CLDISPCONTENT specifies whether the name, the number, or both will be displayed for Call Log entries.
## Value Operation
## 0 Both the name and the number will be displayed
## 1 Only the name will be displayed (default)
## 2 Only the number will be displayed
## This parameter is supported by:
## 96x1 H.323 R6.0 to 6.6.2 (only supports values of 0 or 1)
## 96x1 H.323 R6.6.3 and later (supports values 0 to 2)
## 96x1 SIP R6.0 and later (only supports values of 0 or 1)
## 96x0 H.323 R3.2 and later
```

```
## CLBACKUPTIMESTAT specifies whether Call Log entries will be backed up only after
## a minimum interval as specified by the value of CLBACKUPTIME.
## Note that this parameter only has an effect if the value of LOGBACKUP is 1.
## Value Operation
## 0 Call Log entries will be backed up as they are created (default)
## 1 Call Log entries will be backed up after the interval specified by CLBACKUPTIME
## This parameter is supported by:
## 96x0 H.323 R3.1.3 and later
## 96x1 H.323 R6.6.3 and later
## SET CLBACKUPTIMESTAT 1
##
## CLBACKUPTIME specifies the minimum interval, in minutes, between backups of the Call Log,
## if the values of LOGBACKUP and CLBACKUPTIMESTAT are both 1.
## For 96x0 H.323, Valid values are 10 through 60; the default value is 15.
## For 96x1 H.323, Valid values are 1 through 60; the default value is 15.
## This parameter is supported by:
## 96x0 H.323 R3.1.3 and later
## 96x1 H.323 R6.6.3 and later
## SET CLBACKUPTIME 20
```

License Agreements

License agreements are available at <https://support.avaya.com/Copyright>. Please select 96x1 H.323.

2016 Avaya Inc. All Rights Reserved.

Notice

While reasonable efforts were made to ensure that the information in this document was complete and accurate at the time of printing, Avaya Inc. can assume no liability for any errors. Changes and corrections to the information in this document may be incorporated in future releases.

Documentation disclaimer.

Avaya Inc. is not responsible for any modifications, additions, or deletions to the original published version of this documentation unless such modifications, additions, or deletions were performed by Avaya.

Link disclaimer

Avaya Inc. is not responsible for the contents or reliability of any linked Web sites referenced elsewhere within this Documentation, and Avaya does not necessarily endorse the products, services, or information described or offered within them. We cannot guarantee that these links will work all of the time and we have no control over the availability of the linked pages.