


---

**Comcode: 700184450**  
**Issue 1, July 2001**

**302D ATTENDANT CONSOLE INSTALLATION WARNINGS**

**FAILURE TO HEED THE INFORMATION AND WARNINGS IN THESE INSTRUCTIONS CAN CAUSE DAMAGE TO THE TERMINAL OR CAUSE THE ASSOCIATED PBX CIRCUITPACK TO REMOVE POWER TO THE TERMINAL. IN EITHER CASE THE TERMINAL WILL NOT FUNCTION CORRECTLY.**

**WIRING INFORMATION**

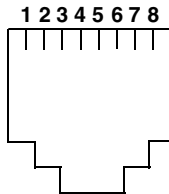

**A Voice Terminal Line Jack**

MODULAR WALL JACK WIRING			
PIN	PAIR	COLOR	DESCRIPTION
1	2	W-O	4-Wire Output
2	2	O-W	4-Wire Output
3	3	W-G	4-Wire Input
4	1	BL-W	2-Wire (Tip)
5	1	W-BL	2-Wire (Ring)
6	3	G-W	4-Wire Input
7	4	W-BR	Adjunct Power -48 v
8	4	BR-W	Adjunct Power Common

The 302D Console operates only on 2-wire DCP circuits. In order for the terminal to function properly, there must be **NO INTERCONNECTIONS** between the wire pairs used for 2-wire or 4-wire operation. Bridging or paralleling of these pairs can result in damage to the terminal or can cause the PBX circuit pack to remove power to the terminal.

**REMOVE ALL CONNECTIONS BETWEEN PAIRS BEFORE CONNECTING THE TERMINAL.**

---

## WIRING INFORMATION (continued)

2-Wire installations MUST ONLY have PBX connections on Pair 1 and, if necessary, auxiliary power must be connected to Pair 4.

The above rules apply to the 302-type Attendant Console, 6400 and 8400 Series voice terminals, and the 603-type Callmaster.



**WARNING:** To prevent terminal damage, verify that cross connections and wiring inside of connector block do not bridge or parallel cable pairs. Refer to the installation documentation before installing the terminal.



**WAARSCHUWING:** Om beschadiging aan het eindapparaat te voorkomen, dient te worden gecontroleerd dat dwarsverbindingen en bedrading in een aansluitblok niet dwars over of langs kabelroutes worden geleid. Raadpleeg de installatiedocumentatie alvorens het eindapparaat te installeren.



**警告：** 端末の破損を防止するために、コネクタブロック内の配線およびジャンパー接続がペアケーブルにブリッジしたり平行になっていないか確認してください。端末の設置前には、設置マニュアルを参照してください。



**CUIDADO:** Para evitar dano no terminal, verifique se as conexões cruzadas e fios dentro do bloco conector não fazem ligação em ponte ou em paralelo nos pares de cabos. Consulte a documentação de instalação antes de instalar o terminal.



**ATTENTION:** Consultez la documentation d'installation avant de brancher le poste et vérifiez qu'aucun cablage en parallèle n'existe aux répartiteurs ou à la prise.



**AVISO:** Para evitar daños en el aparato, compruebe que el cableado de los pares de hilos no presente cortocircuitos ni circuitos abiertos en el interior del bloque de conexiones. Antes de instalar el aparato, consulte la documentación.



**WARNUNG:** Um Beschädigungen des Terminals zu vermeiden, ist sicherzustellen, daß die Verkabelung in der Anschlußdose korrekt durchgeführt ist. Insbesondere dürfen weder Kurschlüsse und Parallelschaltung von den Kabeln vorhanden sein. Lesen Sie unbedingt das Installationschandbuch vor dem Anschließen des Terminals.



**ATTENZIONE:** Per evitare danni al terminale, controllare che i cablaggi e le interconnessioni all'interno della scatola di derivazione non siano disposti in modo trasversale o parallelo rispetto ai doppi. Consultare la documentazione relativa all'installazione prima di installare il terminale.



**ATTENTION:** Afin d'éviter tout dommage à l'appareil, vérifiez les branchements croisés et le filage à l'intérieur du bloc-connecteur; les fils torsadés ne peuvent être ni en parallèle ni combinés. Veuillez consulter les documents d'installation avant de procéder à l'installation de l'appareil.

### THE "CE" MARK



The "CE" mark affixed to this equipment means that the unit complies with directives shown in the Declaration of Compliance located at <http://support.avaya.com/elmodocs2/DoC/>

---

**Hearing Aid Compatibility:** This Console is Hearing Aid Compatible (HAC).

## **THE ENHANCED ATTENDANT CONSOLE (302D TYPE)**

The 302D Enhanced Attendant Console has four new features described directly below.

### **Momentary Push Button Switch**

The momentary action push button switch on the left side of the 302D console activates and deactivates the console.

### **Handset/Headset Volume Control**

The 302D allows you to adjust the handset/headset volume on the console and displays the volume level as a graph on the display.

### **Expander Option**

The 302D expander reduces the amount of background noise that is transmitted during speech pauses. You can enable or disable this option as outlined in the *Console Operations Manual*, 555-230-700.

### **Font Option**

You can now select to display either Eurofont or Katakana characters as outlined in the *Console Operations Manual*, 555-230-700.

## **PROCEDURE TO DOWNLOAD TERMINAL PARAMETERS ON DEMAND FOR THE ATTENDANT CONSOLE:**

When consoles are installed at the customer site, the technician should download the parameters stored on the DEFINITY switch. The technician can cause the Console to be downloaded from either the admin station or from another terminal. With either method the Console must be on-hook to be downloaded (press the button on the side of the console to place it On Hook).

From the admin station the technician issues a busy out and release command for the Console.

From another terminal the technician dials the Refresh Terminals parameters access code and then dials the station number assigned to the Console.



Copyright © 2001 Avaya Inc. All Rights Reserved.